
TABLE1: TEST REQUIREMENTS			
GEOMETRY (TG):	SEE BOM ITEMS 600-603		
LOSS - IL/RL (TL):	SEE BOM ITEMS 604-607		
FIBERCHEK (TF):	SEE BOM ITEMS 608-611		

TABLE 2 : POLARITY (2F,A-B,WH/W-WH/Y,X)							
P1-END		P2-END					
BOOT/HS	POS	POS	BOOT/HS				
WHT-WHT	Α —	В	WHT-WHT				
WHT-YEL	В —	<b>—</b> A	WHT-YEL				

TABLE 3: CUSTOMER PART# AND LENGTH						_
CUSTOMER PART # (SEE PO)	LENGTH AND UNITS (xu)	TOLERANCE	PRODUCT LABEL DATA (product data, x = LENGTH)	ZONE -	REV A	ļ
SAMPLE (TBD)	xxxFT (xxx = 0-3)	(+0.25FT / -0)				L
	xxxFT (xxx = 4-25)	(+0.50FT / -0)	LC/LC 2F xFT			
	xxxFT (xxx = 26-50)	(+0.75FT / -0)	LO/LO 21 X1 1			
	xxxFT (xxx > 50)	(+1.00FT / -0)				
SAMPLE (TBD)	xxxM (xxx = 0-7)	(+0.152M / -0)	LC/LC 2F xM			
	xxxM (xxx = 8-15)	(+0.228M / -0)				
	xxxM (xxx > 15)	(+0.304M / -0)				
xxx = CUSTOMER ORDER LENGTH						
		·		-		

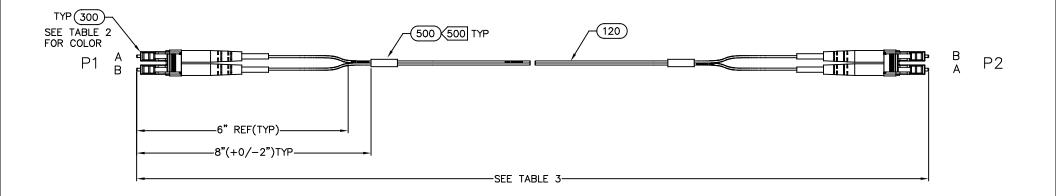

GENERAL NOTES UNLESS OTHERWISE SPECIFIED: (1450-JMPR-WPD)

1. ASSEMBLY LENGTHS ARE FROM FERRULE TIP, CENTER OR EDGE OF TRANSITION, BLUNT END OR BACK OF BOOT 2. ALL DIMENSIONS MEASURED WITH STRAIGHTENED LENGTH AND AFTER FINISHED

3. ALL CONNECTORS SHALL BE SHIPPED WITH FERRULES PROTECTED BY REMOVABLE CAPS

(500 LABEL TEXT:

customer part# product data so#-line#-assy#-mmddyy customer part# = SEE TABLE 3 FOR WO PART# OR DESCRIPTION product data = PRODUCT DATA IN TABLE 3 FOR WO PART# OR DESC so# = WO#, line# = LINE#, assy# = 001 THRU QTY (6-3-3) mm = MONTH, dd = DAY AND yy = YEAR OF MANUFACTURE

- PULLING EYE: NOT REQUIRED
- REEL: >150 FEET BOM LENGTH, P1 END OUT

## SEE BOM ON WORKORDER TRAVELER

REVISION HISTORY-ALL SHEETS ARE AT THE SAME REVISION

DESCRIPTION

A INTIAL\_RELEASE

DATE APPROVED

07/03/19 JPEARCE

DESCRIPTION DWG,2F,LC/LC,3.0,0PE NO PULLEYE CUSTOMER'S DWG NO. DWG NO. **Cables Direct** LCD2FLCLC N/A DRAWN BY: JPEARCE DATE: 07/03/19 REV SCALE: NONE CHECKED BY: TCARMODY DATE: 07/03/19 SHEET 1 OF 1 APPROVED BY: LARMSTRONG DATE: 07/03/19